Reserve Study Level III

Prepared for Lakemoor Community Club

2019 Fiscal Year



Prepared by CEDCORE, LLC Version 1 © 2018 CEDCORE, LLC



Contents

1. Executive Summary

1.1 Table 1 - Component List

- 2. Financial Analysis
 - 2.1 Figure 1 Reserve Fund Ending Balance vs Fully Funded Balance
 - 2.2 Figure 2 Reserve Fund Ending Balance vs Reserve Expenses
 - 2.3 Figure 3 Percent Funded Comparison
 - 2.4 Figure 4 Reserve Contribution Comparison
 - 2.5 Funding Plan 30 Year Reserve Fund Projections
 - 2.5.1 Current Funding Plan
 - 2.5.2 Baseline Funding Plan
 - 2.5.3 Full Funding Plan
 - 2.6 Funding Plan Cash Flow Projections
- 3. Physical Analysis
 - 3.1 Table 2 Component Funding Basis
 - 3.2 Table 3 Component Metrics
 - 3.3 Component Details
- 4. How to Read Your Reserve Study
 - 4.1 About Reserve Studies
 - 4.2 Reserve Study Levels
 - 4.3 Percent Funded
 - 4.4 Reserve Funding Plans & Goals
 - 4.5 Reserve Contributions
 - 4.6 Reserve Components
 - 4.7 Implementing Your Reserve Study
- 5. Supplemental Report Information
 - 5.1 Definitions
 - 5.2 Table 4 RCW Required Information & Location
 - 5.3 Reserve Study Disclosure



1. Executive Summary

	F	Report Details		
Association Name:	Lakemoor Communit	y Club		
Location:	Olympia, WA	Number of Units:	288	
Level of Service:	Level III	Site Visit Date:	N/A	
Report Period:	FY 2019	Projection Period:	2019 - 2048	
Reserve Account Snap S	hot January 1, 2019			
Projected Reserve Balar	nce:			\$19,996
Fully Funded Reserve Ba	alance:			\$171,107
Percent Funded:				12 %
Reserve Surplus or (-) D	eficit Per Unit:			(\$525)
Current Monthly Reserv	e Fund Contribution:			\$2,500
Interest Rate				1.00 %
Inflation Rate				4.30 %
2019 Reserve Contribut	ion Requirements (based	on the above position)		
Full Funding	Monthly Reserve Cor	ntribution:		\$3,050
	Monthly Reserve Cor	ntribution Per Unit (Average):		\$11
	Special Assessment R	Required for this Plan:		\$0
Baseline Funding	Monthly Reserve Cor	ntribution:		\$2,431
	Monthly Reserve Cor	ntribution Per Unit (Average):		\$8
	Special Assessment R	Required for this Plan:		\$0

Based upon the budget and maintenance practices of the association we have used a funding threshold of \$1,295. Expenses below \$1,295 are not funded within this report and best treated as a maintenance expense. We have included comments within the Component Analysis Section of this report.

The Association will need to increase the contribution by \$5.73 average per unit per quarter to get onto the path to becoming Fully Funded.



1.1 Table 1 - Component List

Asphalt: Seal 19,204 Square Feet \$6,150 5 basketball Assembly: Replace 2 Each \$5,340 15 1 bock: Repair 1 Allowance \$3,130 3 3 3 bock: Replace 220 Square Feet \$47,000 25 22 bock: Replace 3 Units \$12,800 20 2 bock: Replace 3 Units \$12,800 20 2 bock: Swim Floats 3 Units \$12,800 20 2 bock: Replace 3 Units \$12,800 20 2 creace: Chainlink, Replace 3 Units \$12,900 30 11 ence: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 11 ence: Chainlink, Replace Basket Ball Court 1 Allowance \$2,200 30 11 ence: Chainlink, Replace 1 Allowance \$2,200 30 12 ence: Chainlink, Replace 1 Allowance \$2,200 30 12 ence: Chainlink, Replace 1 Allowance	Component	Quantity	Current Cost	UL	RUL
Allowance \$5,340 15 1 Dock: Repair 1 Allowance \$5,340 2 2 Dock: Replace 220 Square Feet \$47,000 25 2 Dock: Replace 220 Square Feet \$101,000 25 2 Dock: Replace 3 Units \$12,800 20 20 Dock: Swim Floats 3 Units \$12,800 20 20 Dock: Swim Floats 3 Units \$12,800 20 20 Dock: Swim Floats 3 Units \$12,800 20 20 Serve: Chainlink, Replace 1 Allowance \$9,400 25 2 Serve: Chainlink, Replace 588 Linear Feet \$14,00 30 21 Serve: Refurbish 1 Allowance \$6,470 5 5 32 Serve: Replace Unfunded, not Association responsibility 4 4 4 Ast: Sift & Debris Removal 1 Allowance \$5,200 4 4 Ast: Sift & Debris Removal 1 Allowance \$12,000 30 1 Jagketball Court: Resplace Unfunded, not Association responsibility <td>Asphalt: Resurface</td> <td>19,204 Square Feet</td> <td>\$52,800</td> <td>50</td> <td>7</td>	Asphalt: Resurface	19,204 Square Feet	\$52,800	50	7
Dock: Repair 1 Allowance 53,130 3 5 Dock: Replace 220 Square Feet \$47,000 25 2 Dock: Replace 220 Square Feet \$10,000 25 2 Dock: Replace 3 Units \$12,800 20 3 Dock: Swim Floats 3 Units \$12,800 20 3 Dock: Chainlink, Replace 1 Allowance \$9,400 25 2 rence: Chainlink, Replace 588 Linear Feet \$12,900 30 1 rence: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 2 servel : Refurbish 1 Allowance \$2,000 30 1 rigation System: Repair 1 Allowance \$2,000 30 1 adscaping: Refurbish 1 Allowance \$2,000 30 1 adscaping: Refurbish 1 Allowance \$2,000 30 1 dights: Pole, Replace Unfunded, not Association responsibility 4 1 vdower: Replace 1 Unit \$10,700 <td>Asphalt: Seal</td> <td>19,204 Square Feet</td> <td>\$6,150</td> <td>5</td> <td>2</td>	Asphalt: Seal	19,204 Square Feet	\$6,150	5	2
Sock: Replace 220 Square Feet \$47,00 25 2 Sock: Replace 425 Square Feet \$101,000 25 2 Sock: Swim Floats 3 Units \$12,800 20 25 Strainage Unfunded due to unpredictable nature of component 20 22 ence: Chainlink, Replace 588 Linear Feet \$12,900 30 11 ence: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 22 sravel : Refurbish 1 Allowance \$2,100 5 5 rrigation System: Repair 1 Allowance \$2,000 30 1 adscaping: Refurbish 1 Allowance \$2,000 30 1 ights: Pole, Replace Unfunded, not Association responsibility 1 1 vower: Replace Unfunded, not Association responsibility 1 1 vower: Replace 1 Allowance \$16,300 25 1 vower: Replace 1 Unit \$23,500 26 1 vower: Replace 1 Allowance \$4,9	Basketball Assembly: Replace	2 Each	\$5,340	15	11
425 Square Feet \$101,000 25 22 bock: Byim Floats 3 Units \$12,800 20 20 brainage Unfunded due to unpredictable nature of component 25 22 ence: Chainlink, Replace 1 Allowance \$9,400 25 22 ence: Chainlink, Replace 588 Linear Feet \$12,900 30 11 ence: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 22 sravel : Refurbish 1 Allowance \$2,000 5 5 rigation System: Repair 1 Allowance \$2,000 30 10 adscaping: Refurbish 1 Allowance \$2,000 30 10 adscaping: Refurbish 1 Allowance \$5,200 4 10 ights: Pole, Replace Unfunded, not Association responsibility 10	Dock: Repair	1 Allowance	\$3,130	3	8
Souck: Swim Floats 3 Units \$12,800 20 Drainage Unfunded due to unpredictable nature of component intry Monument: Repair/Replace 1 Allowance \$9,400 25 22 ience: Chainlink, Replace 588 Linear Feet \$12,900 30 12 ience: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 22 sravel : Refurbish 1 Allowance \$2,100 50 32 sravel : Refurbish 1 Allowance \$2,000 30 20 adscaping: Refurbish 1 Allowance \$2,000 30 20 adscaping: Refurbish 1 Allowance \$5,200 4 40 ights: Pole, Replace Unfunded, not Association responsibility 40 validbox Cluster: Replace Unfunded, not Association responsibility 40 validbox Cluster: Replace Unfunded operating expense 10 valid Equipment: Rope Dome Replacement 1 Unit \$23,500 25 valid Equipment: Rope Acelize Expense 1 Allowance \$14,170 12 vatreets	Dock: Replace	220 Square Feet	\$47,000	25	23
Analysis Unfunded due to unpredictable nature of component intry Monument: Repair/Replace 1 Allowance \$9,400 25 27 ience: Chainlink, Replace 588 Linear Feet \$12,900 30 17 ience: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 27 ience: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 27 ience: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 27 ience: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 27 ience: Chainlink, Replace Basket Ball Court 1 Allowance \$2,000 30 40 irrigation System: Repair 1 Allowance \$2,000 30 40 adscaping: Refurbish 1 Allowance \$2,000 30 40 ights: Pole, Replace Unfunded, not Association responsibility 41 41 41 41 41 41 41 41 41 41 41 41 41 41 41 41 <td>Dock: Replace</td> <td>425 Square Feet</td> <td>\$101,000</td> <td>25</td> <td>23</td>	Dock: Replace	425 Square Feet	\$101,000	25	23
intry Monument: Repair/Replace 1 Allowance \$9,400 25 25 ience: Chainlink, Replace 588 Linear Feet \$12,900 30 12 ience: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 27 ience: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 27 ience: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 27 isravel : Refurbish 1 Allowance \$2,100 5 37 ake: Silt & Debris Removal 1 Allowance \$6,470 5 37 ake: Silt & Debris Removal 1 Allowance \$20,000 30 47 andscaping: Refurbish 1 Allowance \$5,200 4 47 ights: Pole, Replace Unfunded, not Association responsibility 40 41 valibox Cluster: Replace Unfunded, not Association responsibility 40 41 value Equipment: Rope Dome Replacement 1 Unit \$10,700 10 41 value Equipment: Rope Dome Replacement 1 Allowance \$4,950 8 41 value Equipment: Rope Dome Repla	Dock: Swim Floats	3 Units	\$12,800	20	8
ience: Chainlink, Replace 588 Linear Feet \$12,900 30 11 ience: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 21 ience: Chainlink, Replace Basket Ball Court 438 Linear Feet \$16,400 30 21 iaravel : Refurbish 1 Allowance \$2,100 5 5 5 irrigation System: Repair 1 Allowance \$6,470 5 5 5 ake: Silt & Debris Removal 1 Allowance \$5,200 4 4 4 ights: Pole, Replace Unfunded, not Association responsibility 4 4 4 4 valibox Cluster: Replace Unfunded, not Association responsibility 4 4 4 value: Replace 1 Unit \$10,700 10 4 4 value: Replace 1 Unit \$10,700 10 4 4 value: Replace 1 Unit \$10,700 10 4 4 value: Replace 1 Unit \$23,500 25 1 1 value: Replace 1 Unit \$23,500 25 1 1 <td>Drainage</td> <td>Unfunded due to unpredictable</td> <td>nature of component</td> <td>t</td> <td></td>	Drainage	Unfunded due to unpredictable	nature of component	t	
rence: Chainlink, Replace Basket Ball Court438 Linear Feet\$16,4003020Gravel : Refurbish1 Allowance\$2,10053arrigation System: Repair1 Allowance\$6,47053ake: Silt & Debris Removal1 Allowance\$20,000304andscaping: Refurbish1 Allowance\$5,20044ights: Pole, ReplaceUnfunded, not Association responsibility4Mower: Replace1 Unit\$10,700105Vower: Replace1 Unit\$10,700105Vower: Replace1 Unit\$10,700105Vower: Replace1 Unit\$23,500251Vale Equipment: Rope Dome Replacement1 Unit\$23,500251Vich Casets1 Allowance\$4,95085ighs / Pet Stations: ReplaceUnfunded operating expense11ights / Pet Stations: Replace1 Unit\$21,000151itorage Rack: Canoe & Peddle Boat3 Units\$4,1701251itorage Rack: Canoe & Peddle Boat1 Unit\$21,4002511itorage Structure: Replace1 Unit\$21,400251itorage Structure: Replace1 Unit\$21,400251itorage Rack: Canoe & Peddle Boat1 Unit\$21,400251itorage Rack: Replace1 Unit\$21,400251itorage Rack: Replace1 Unit\$21,000251	Entry Monument: Repair/Replace	1 Allowance	\$9,400	25	22
Gravel : Refurbish1 Allowance\$2,10055rrigation System: Repair1 Allowance\$6,47055ake: Silt & Debris Removal1 Allowance\$20,000304andscaping: Refurbish1 Allowance\$5,20044ights: Pole, ReplaceUnfunded, not Association responsibility4Vower: ReplaceUnfunded, not Association responsibility10Vower: Replace1 Unit\$10,70010Picnic Assets1 Allowance\$16,30025Piay Equipment: Rope Dome Replacement1 Unit\$23,5002510Vihed: Repair1 Unit\$23,5002510Vihed: Repair1 Unit\$23,5002510ided: Repair Allowance1 Allowance\$4,950810vitorage Rack: Canoe & Peddle Boat3 Units\$4,1701212vitorage Rack: Canoe & Peddle Boat3 Units\$4,1701212vitorage Rack: Canoe & Peddle Boat1 Allowance\$11,0002512vitorage Rack: Canoe & Peddle Boat1 Unit\$21,4002512vitorage Rack: Canoe & Peddle Boat1 Allowance\$11,0002512vitorage Rack: Replace1 Unit\$21,4002512vitorage Rack: Replace1 Allowance\$11,0002512vitorage Rack: Replace1 Allowance\$11,0002512vitorage Rack: Replace1 Allowance\$11,0002512vitorage Rac	Fence: Chainlink, Replace	588 Linear Feet	\$12,900	30	13
rrigation System: Repair 1 Allowance \$6,470 5	Fence: Chainlink, Replace Basket Ball Court	438 Linear Feet	\$16,400	30	26
ake: Silt & Debris Removal1 Allowance\$20,00030andscaping: Refurbish1 Allowance\$5,20044ights: Pole, ReplaceUnfunded, not Association responsibility4Mailbox Cluster: ReplaceUnfunded, not Association responsibility10Mower: Replace1 Unit\$10,70010Picnic Assets1 Allowance\$16,30025Picnic Assets1 Allowance\$16,3002514Picnic Assets1 Allowance\$16,3002514Picnic Assets1 Allowance\$4,950816Picnic Assets1 Allowance\$4,950816Picnic Assets1 Allowance\$11,5001516Picnic Assets1 Allowance\$11,5001516Picnic Assets3 Units\$4,1701225Picnic Repara3 Units\$4,1701225Picot Resurface1 Unit\$21,4002516Picot Resurface1 Unit\$21,4002516Picot Resurface1 Unit\$21,4002516Picot Resurface1 Unit\$21,4002516Picot Resurface1 Allowance\$11,0002516Picot Resurface1 Allowance\$11,0002516Picot Resurface1 Allowance\$11,0002516Picot Resurface1 Allowance\$11,0002516Picot Resurface1 Allowance\$11,0002516<	Gravel : Refurbish	1 Allowance	\$2,100	5	2
andscaping: Refurbish1 Allowance\$5,2004ights: Pole, ReplaceUnfunded, not Association responsibilityMailbox Cluster: ReplaceUnfunded, not Association responsibilityMower: Replace1 Unit\$10,70010Picnic Assets1 Allowance\$16,300251Play Equipment: Rope Dome Replacement1 Unit\$23,500251Sided: Repair Allowance1 Allowance\$4,95081Signs / Pet Stations: ReplaceUnfunded operating expense1151Storage Rack: Canoe & Peddle Boat3 Units\$4,1701212Storage Rack: Canoe & Peddle Boat1 Unit\$21,400251Wing Set Toy Structure: Replace1 Unit\$21,400251Wing Sets: Replace1 Allowance\$11,000251Wing Sets: Replace1 Unit\$21,400251Total Current Costs\$415,210251	Irrigation System: Repair	1 Allowance	\$6,470	5	3
ights: Pole, Replace Unfunded, not Association responsibility Mailbox Cluster: Replace Unfunded, not Association responsibility Mower: Replace 1 Unit \$10,700 10 10 10 10 10 10 10 10 10 10 10 10 1	Lake: Silt & Debris Removal	1 Allowance	\$20,000	30	0
Aailbox Cluster: ReplaceUnfunded, not Association responsibilityMower: Replace1 Unit\$10,7001010Picnic Assets1 Allowance\$16,3002510Piay Equipment: Rope Dome Replacement1 Unit\$23,5002510Piay Equipment: Rope Dome Replacement1 Unit\$23,5002510Piay Equipment: Rope Dome Replacement1 Allowance\$4,950810Piay Equipment: ReplaceUnfunded operating expense11511Bigns / Pet Stations: Replace1 Allowance\$11,5001511Biort Court: Resurface1 Allowance\$11,5001511Biorage Rack: Canoe & Peddle Boat3 Units\$4,1701212BitraetsUnfunded, not Association responsibility101511Bitraets1 Unit\$21,4002512Bitraets1 Unit\$21,4002512Bitraets1 Allowance\$11,0002512Bitraets1 Allowance\$11,0002512Bitraets1 Allowance\$11,0002512Bitraets1 Allowance\$11,0002514Bitraets1 Allowance\$11,0002514Bitraets1 Allowance\$11,0002514Bitraets1 Allowance\$11,0002514Bitraets1 Allowance\$11,0002514Bitraets1 Allowance\$11,0002514 <tr <td=""><</tr>	Landscaping: Refurbish	1 Allowance	\$5,200	4	0
Mower: Replace1 Unit\$10,70010Picnic Assets1 Allowance\$16,3002514Play Equipment: Rope Dome Replacement1 Unit\$23,5002514Shed: Repair Allowance1 Allowance\$4,950816Signs / Pet Stations: ReplaceUnfunded operating expense101511Storage Rack: Canoe & Peddle Boat3 Units\$4,1701212Storage Rack: Canoe & Peddle Boat1 Unit\$21,4002516Storage Set Toy Structure: Replace1 Unit\$21,4002516Storage Sets: Replace1 Allowance\$11,0002516Storage Sets: Replace1 Allowance\$415,2102516Storage Sets: Replace1 Allowance\$11,00025 </td <td>Lights: Pole, Replace</td> <td>Unfunded, not Association respo</td> <td>onsibility</td> <td></td> <td></td>	Lights: Pole, Replace	Unfunded, not Association respo	onsibility		
Picnic Assets1 Allowance\$16,300251Play Equipment: Rope Dome Replacement1 Unit\$23,500251Shed: Repair Allowance1 Allowance\$4,95081Signs / Pet Stations: ReplaceUnfunded operating expense11Sport Court: Resurface1 Allowance\$11,500151Storage Rack: Canoe & Peddle Boat3 Units\$4,1701212Storage Rack: Canoe & Peddle Boat1 Unfunded, not Association responsibility11Swing Set Toy Structure: Replace1 Unit\$21,400251Swing Sets: Replace1 Allowance\$11,000251Swing Sets: Replace1 Allowance\$11,000251Swing Sets: Replace1 Allowance\$11,000251Storage Rack: Canoe & Storage1 Allowance\$11,000251Storage Sets: Replace1 Allowance\$11,000251Storage Sets: Replace1 Allowance\$415,210251Storage Sets: Replace1 Allowance\$4	Mailbox Cluster: Replace	Unfunded, not Association respo	onsibility		
Play Equipment: Rope Dome Replacement1 Unit\$23,50025100Shed: Repair Allowance1 Allowance\$4,9508100Signs / Pet Stations: ReplaceUnfunded operating expense111Sport Court: Resurface1 Allowance\$11,5001511Storage Rack: Canoe & Peddle Boat3 Units\$4,1701212Storage Rack: Canoe & Peddle Boat1 Unfunded, not Association responsibility112Storage Set Toy Structure: Replace1 Unit\$21,4002510Swing Sets: Replace1 Allowance\$11,0002510Swing Sets: Replace1 Allowance\$11,0002510Total Current Costs\$415,210101010	Mower: Replace	1 Unit	\$10,700	10	5
Shed: Repair Allowance1 Allowance\$4,9508Signs / Pet Stations: ReplaceUnfunded operating expense1Sport Court: Resurface1 Allowance\$11,5001515Storage Rack: Canoe & Peddle Boat3 Units\$4,1701212Storage Rack: Canoe & Peddle Boat3 Units\$4,1701212Storage Rack: Canoe & Peddle Boat1 Unfunded, not Association responsibility1212Storage Set Toy Structure: Replace1 Unit\$21,4002512Swing Sets: Replace1 Allowance\$11,0002514Swing Sets: Replace1 Allowance\$11,0002514Total Current Costs\$415,21014\$415,21014	Picnic Assets	1 Allowance	\$16,300	25	14
Signs / Pet Stations: ReplaceUnfunded operating expenseSigns / Pet Stations: Replace1 Allowance\$11,5001515Signs / Pet Stations: Replace3 Units\$4,1701212Signs / Pet Stations: ReplaceUnfunded, not Association responsibility112Signs Set Toy Structure: Replace1 Unit\$21,4002515Signs Sets: Replace1 Allowance\$11,0002516Signs Sets: Replace1 Allowance\$11,0002516Total Current Costs\$415,2101616	Play Equipment: Rope Dome Replacement	1 Unit	\$23,500	25	16
Sport Court: Resurface1 Allowance\$11,500151Storage Rack: Canoe & Peddle Boat3 Units\$4,1701212StreetsUnfunded, not Association responsibilitySwing Set Toy Structure: Replace1 Unit\$21,40025Swing Sets: Replace1 Allowance\$11,00025Swing Sets: Replace1 Allowance\$11,00025Total Current Costs\$415,21014	Shed: Repair Allowance	1 Allowance	\$4,950	8	6
itorage Rack: Canoe & Peddle Boat 3 Units \$4,170 12 structures Unfunded, not Association responsibility 521,400 25 structure: Replace 1 Unit \$21,400 25 structures: Replace 1 Allowance \$11,000 25 structures Replace 1 Allowance 1 Allowance \$11,000 25 structures Replace 1 Allowance 1	Signs / Pet Stations: Replace	Unfunded operating expense			
Unfunded, not Association responsibility Swing Set Toy Structure: Replace 1 Unit \$21,400 25 Swing Sets: Replace 1 Allowance \$11,000 25 Swing Sets: Replace 1 Allowance \$11,000 25 Total Current Costs \$415,210	Sport Court: Resurface	1 Allowance	\$11,500	15	11
iwing Set Toy Structure: Replace 1 Unit \$21,400 25 iwing Sets: Replace \$11,000 25 iwing Sets: Replace \$11,000 25 10 Total Current Costs \$415,210	Storage Rack: Canoe & Peddle Boat	3 Units	\$4,170	12	9
wing Sets: Replace1 Allowance\$11,00025wing Sets: Replace1 Allowance\$11,0002510Total Current Costs\$415,210	Streets	Unfunded, not Association respo	onsibility		
iwing Sets: Replace 1 Allowance \$11,000 25 10 Total Current Costs \$415,210	Swing Set Toy Structure: Replace	1 Unit	\$21,400	25	1
Total Current Costs \$415,210	Swing Sets: Replace	1 Allowance	\$11,000	25	1
	Swing Sets: Replace	1 Allowance	\$11,000	25	16
Total Funded Components 23		Total Current Costs	\$415,210		
		Total Funded Components	23		

Components without a UL are one-time expenses, not expecting to reoccur at this time. It is important to note that actual costs may vary significantly based on scope of work, actual conditions, hidden deterioration, vendor selection, etc. This component list is for budget planning purposes only.




2. Financial Analysis

We have created the financial projections and recommendations based on the component list in Table One and a projected reserve fund balance \$19,996. For your Association to be 100% funded there should be \$171,107 in your reserve account(s). Therefore, your Association is projected to be 12.00% funded.


We recommend the Full Funding, which requires a monthly reserve contribution of \$3,050 with a 3.00 % increase in contributions each year for the next 30 years.

Currently the Association has monthly reserve contributions of \$2,500 and are projected to be sufficient over the next 30 years. The Baseline monthly reserve contribution requires \$2,431, with a 3.00 % increase in contributions each year for the next 30 years. The baseline funding plan is the lowest contribution amount calculated to prevent the Reserve Fund from dropping below a zero balance.

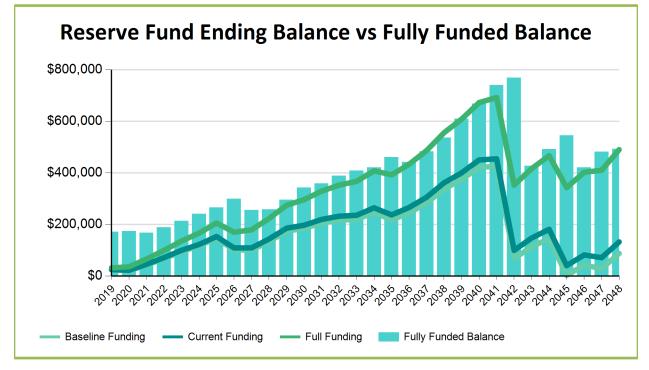

2.1 Figure 1 - Reserve Fund Ending Balance vs Fully Funded Balance




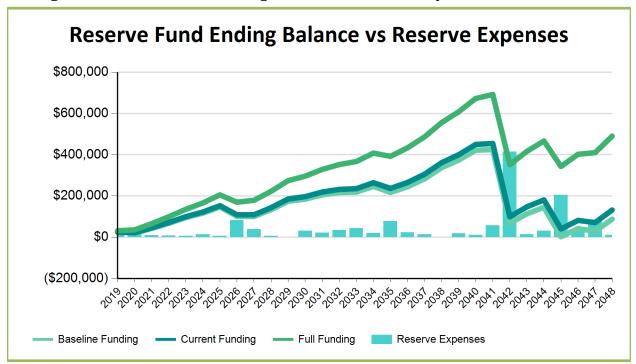


2.2 Figure 2 - Reserve Fund Ending Balance vs Reserve Expenses





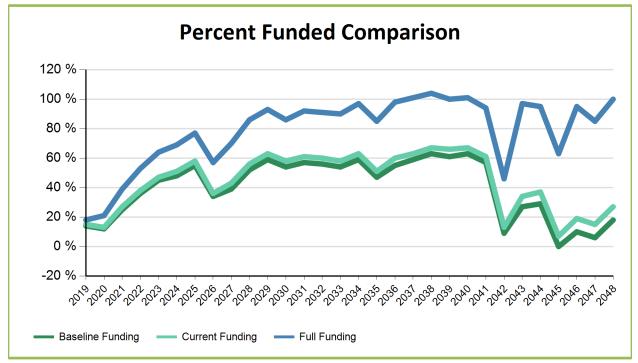

2.4 Figure 4 – Reserve Contribution Comparison

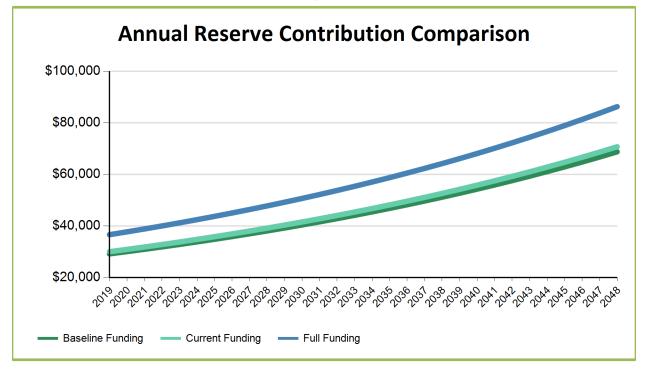



2.5.1 - 30 Year Reserve Fund Projection (Current Funding)

Current	Funding Plan							
Year	Start Balance	Annual Reserve Contribution	Special Assessments	Additional Assessments Necessary Per Unit /Per Year	Interest Income	Reserve Expenses	Fully Funded Balance	Percent Funded
2019	\$19,996	\$30,000	\$0		\$98	\$25,200	\$171,107	14.55 %
2020	\$24,894	\$30,900	\$0		\$66	\$33,793	\$173,423	12.72 %
2021	\$22,067	\$31,827	\$0		\$290	\$8,974	\$167,790	26.94 %
2022	\$45,210	\$32,782	\$0		\$543	\$7,341	\$188,752	37.72 %
2023	\$71,194	\$33,765	\$0		\$819	\$6,154	\$213,313	46.70 %
2024	\$99,624	\$34,778	\$0		\$1,038	\$13,207	\$241,206	50.68 %
2025	\$122,233	\$35,822	\$0		\$1,338	\$6,373	\$265,365	57.66 %
2026	\$153,020	\$36,896	\$0		\$895	\$81,974	\$298,876	36.42 %
2027	\$108,837	\$38,003	\$0		\$892	\$38,652	\$256,213	42.57 %
2028	\$109,080	\$39,143	\$0		\$1,226	\$6,091	\$258,187	55.52 %
2029	\$143,358	\$40,317	\$0		\$1,635	\$0	\$295,554	62.70 %
2030	\$185,310	\$41,527	\$0		\$1,743	\$31,733	\$342,283	57.51 %
2031	\$196,847	\$42,773	\$0		\$1,959	\$22,291	\$359,387	61.02 %
2032	\$219,288	\$44,056	\$0		\$2,078	\$33,483	\$388,600	59.69 %
2033	\$231,939	\$45,378	\$0		\$2,107	\$43,956	\$408,987	57.57 %
2034	\$235 <i>,</i> 468	\$46,739	\$0		\$2,387	\$20,121	\$420,987	62.82 %
2035	\$264,473	\$48,141	\$0		\$2,107	\$77 <i>,</i> 865	\$460,095	51.48 %
2036	\$236,856	\$49,585	\$0		\$2,384	\$23,280	\$442,463	60.02 %
2037	\$265,545	\$51,073	\$0		\$2,773	\$13,805	\$482,888	63.28 %
2038	\$305,586	\$52,605	\$0		\$3,319	\$0	\$536,898	67.33 %
2039	\$361,510	\$54,183	\$0		\$3,693	\$19,335	\$609,678	65.62 %
2040	\$400,051	\$55,809	\$0		\$4,179	\$10,095	\$667,558	67.40 %
2041	\$449,944	\$57,483	\$0		\$4,216	\$57,065	\$739,792	61.45 %
2042	\$454,578	\$59,208	\$0		\$691	\$415,045	\$768,468	12.94 %
2043	\$99,432	\$60,984	\$0		\$1,156	\$14,283	\$427,428	34.46 %
2044	\$147,289	\$62,813	\$0		\$1,480	\$30,654	\$492,246	36.76 %
2045	\$180,928	\$64,698	\$0		\$78	\$205,490	\$545,413	7.37 %
2046	\$40,214	\$66,639	\$0		\$478	\$25,712	\$421,264	19.37 %
2047	\$81,619	\$68,638	\$0		\$364	\$79,541	\$482,155	14.74 %
2048	\$71,080	\$70,697	\$0		\$958	\$10,612	\$492,512	26.83 %



2.5.3 - 30 Year Reserve Fund Projection (Full Funding)

Full Fundin							
Year	Start Balance	Annual Reserve Contribution	Special Assessments	Interest Income	Reserve Expenses	Fully Funded Balance	Percent Funded
2019	\$19,996	\$36,600	\$0	\$131	\$25,200	\$171,107	18.43 %
2020	\$31,527	\$37,698	\$0	\$166	\$33,793	\$173,423	20.53 %
2021	\$35,598	\$38,829	\$0	\$460	\$8,974	\$167,790	39.28 %
2022	\$65,913	\$39,994	\$0	\$786	\$7,341	\$188,752	52.64 %
2023	\$99,352	\$41,194	\$0	\$1,138	\$6,154	\$213,313	63.54 %
2024	\$135,530	\$42,429	\$0	\$1,435	\$13,207	\$241,206	68.90 %
2025	\$166,187	\$43,702	\$0	\$1,817	\$6,373	\$265,365	77.38 %
2026	\$205,333	\$45,013	\$0	\$1,459	\$81,974	\$298,876	56.82 %
2027	\$169,831	\$46,364	\$0	\$1,544	\$38,652	\$256,213	69.90 %
2028	\$179,087	\$47,755	\$0	\$1,969	\$6,091	\$258,187	86.26 %
2029	\$222,720	\$49,187	\$0	\$2,473	\$0	\$295,554	92.84 %
2030	\$274,380	\$50,663	\$0	\$2,680	\$31,733	\$342,283	86.48 %
2031	\$295,990	\$52,183	\$0	\$2,998	\$22,291	\$359,387	91.51 %
2032	\$328,880	\$53,748	\$0	\$3,223	\$33,483	\$388,600	90.68 %
2033	\$352,368	\$55,361	\$0	\$3,361	\$43,956	\$408,987	89.77 %
2034	\$367,134	\$57,022	\$0	\$3,755	\$20,121	\$420,987	96.87 %
2035	\$407,790	\$58,732	\$0	\$3 <i>,</i> 593	\$77,865	\$460,095	85.25 %
2036	\$392,250	\$60,494	\$0	\$3,992	\$23,280	\$442,463	97.96 %
2037	\$433,456	\$62,309	\$0	\$4,508	\$13,805	\$482,888	100.74 %
2038	\$486,468	\$64,178	\$0	\$5,186	\$0	\$536,898	103.53 %
2039	\$555,832	\$66,104	\$0	\$5 <i>,</i> 695	\$19,335	\$609,678	99.77 %
2040	\$608,296	\$68,087	\$0	\$6,322	\$10,095	\$667,558	100.76 %
2041	\$672,610	\$70,129	\$0	\$6,506	\$57,065	\$739,792	93.56 %
2042	\$692,180	\$72,233	\$0	\$3,133	\$415,045	\$768,468	45.87 %
2043	\$352,501	\$74,400	\$0	\$3,754	\$14,283	\$427,428	97.41 %
2044	\$416,372	\$76,632	\$0	\$4,240	\$30,654	\$492,246	94.79 %
2045	\$466,590	\$78,931	\$0	\$3,006	\$205,490	\$545,413	62.89 %
2046	\$343,037	\$81,299	\$0	\$3,580	\$25,712	\$421,264	95.48 %
2047	\$402,204	\$83,738	\$0	\$3,645	\$79,541	\$482,155	85.04 %
2048	\$410,046	\$86,250	\$0	\$4,426	\$10,612	\$492,512	99.51 %





2.5.2 - 30 Year Reserve Fund Projection (Baseline Funding)

Baseline Funding Plan

		Annual Reserve	Special	Interest	Reserve		
Year	Start Balance	Contribution	Assessments	Income	Expenses	Fully Funded Balance	Percent Funded
2019	\$19,996	\$29,172	\$0	\$94	\$25,200	\$171,107	14.06 %
2020	\$24,062	\$30,047	\$0	\$53	\$33,793	\$173,423	11.75 %
2021	\$20,369	\$30,949	\$0	\$269	\$8,974	\$167,790	25.40 %
2022	\$42,613	\$31,877	\$0	\$512	\$7,341	\$188,752	35.85 %
2023	\$67,661	\$32,833	\$0	\$779	\$6,154	\$213,313	44.59 %
2024	\$95,119	\$33,818	\$0	\$988	\$13,207	\$241,206	48.39 %
2025	\$116,718	\$34,833	\$0	\$1,278	\$6,373	\$265,365	55.19 %
2026	\$146,456	\$35,878	\$0	\$824	\$81,974	\$298,876	33.85 %
2027	\$101,184	\$36,954	\$0	\$810	\$38,652	\$256,213	39.15 %
2028	\$100,296	\$38,063	\$0	\$1,132	\$6,091	\$258,187	51.67 %
2029	\$133,400	\$39,205	\$0	\$1,530	\$0	\$295,554	58.92 %
2030	\$174,135	\$40,381	\$0	\$1,626	\$31,733	\$342,283	53.88 %
2031	\$184,409	\$41,592	\$0	\$1,829	\$22,291	\$359,387	57.19 %
2032	\$205,539	\$42,840	\$0	\$1,935	\$33,483	\$388,600	55.80 %
2033	\$216,831	\$44,125	\$0	\$1,949	\$43,956	\$408,987	53.53 %
2034	\$218,949	\$45,449	\$0	\$2,216	\$20,121	\$420,987	58.55 %
2035	\$246,493	\$46,813	\$0	\$1,920	\$77,865	\$460,095	47.24 %
2036	\$217,360	\$48,217	\$0	\$2,182	\$23,280	\$442,463	55.25 %
2037	\$244,479	\$49,663	\$0	\$2 <i>,</i> 555	\$13,805	\$482,888	58.58 %
2038	\$282,892	\$51,153	\$0	\$3 <i>,</i> 085	\$0	\$536,898	62.79 %
2039	\$337,130	\$52,688	\$0	\$3,441	\$19,335	\$609,678	61.33 %
2040	\$373,924	\$54,269	\$0	\$3,910	\$10,095	\$667,558	63.22 %
2041	\$422,008	\$55,897	\$0	\$3,929	\$57,065	\$739,792	57.42 %
2042	\$424,769	\$57,573	\$0	\$385	\$415,045	\$768,468	8.81 %
2043	\$67,682	\$59,301	\$0	\$830	\$14,283	\$427,428	26.56 %
2044	\$113,530	\$61,080	\$0	\$1,134	\$30,654	\$492,246	29.48 %
2045	\$145,090	\$62,912	\$0	\$0	\$205,490	\$545,413	0.46 %
2046	\$2,512	\$64,799	\$0	\$92	\$25,712	\$421,264	9.90 %
2047	\$41,691	\$66,743	\$0	\$0	\$79,541	\$482,155	5.99 %
2048	\$28,893	\$68,746	\$0	\$527	\$10,612	\$492,512	17.78 %



2.6 Funding Plan Cash Flow Projections

Full Funding Plan					
Year	2019	2020	2021	2022	2023
Percent Funded	18.43 %	20.53 %	39.28 %	52.64 %	63.54 %
Fully Funded Balance	\$171,107	\$173,423	\$167,790	\$188,752	\$213,313
Beginning Balance	\$19,996	\$31,527	\$35,598	\$65,913	\$99,352
Annual Contributions	\$36,600	\$37,698	\$38,829	\$39,994	\$41,194
Interest Earnings	\$131	\$166	\$460	\$786	\$1,138
Special Assessment	\$0	\$0	\$0	\$0	\$0
Reserve Expenses	\$25,200	\$33,793	\$8,974	\$7,341	\$6,154
Ending Balance	\$31,527	\$35,598	\$65,913	\$99,352	\$135,530

Expenses by Component & Year					
Components	2019	2020	2021	2022	2023
Asphalt: Resurface	\$0	\$0	\$0	\$0	\$0
Asphalt: Seal	\$0	\$0	\$6,690	\$0	\$0
Basketball Assembly: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Repair	\$0	\$0	\$0	\$0	\$0
Dock: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Swim Floats	\$0	\$0	\$0	\$0	\$0
Entry Monument: Repair/Replace	\$0	\$0	\$0	\$0	\$0
Fence: Chainlink, Replace	\$0	\$0	\$0	\$0	\$0
Fence: Chainlink, Replace Basket Ball Court	\$0	\$0	\$0	\$0	\$0
Gravel : Refurbish	\$0	\$0	\$2,284	\$0	\$0
Irrigation System: Repair	\$0	\$0	\$0	\$7,341	\$0
Lake: Silt & Debris Removal	\$20,000	\$0	\$0	\$0	\$0
Landscaping: Refurbish	\$5,200	\$0	\$0	\$0	\$6,154
Mower: Replace	\$0	\$0	\$0	\$0	\$0
Picnic Assets	\$0	\$0	\$0	\$0	\$0
Play Equipment: Rope Dome Replacement	\$0	\$0	\$0	\$0	\$0
Shed: Repair Allowance	\$0	\$0	\$0	\$0	\$0
Sport Court: Resurface	\$0	\$0	\$0	\$0	\$0
Storage Rack: Canoe & Peddle Boat	\$0	\$0	\$0	\$0	\$0
Swing Set Toy Structure: Replace	\$0	\$22,320	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$0	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$11,473	\$0	\$0	\$0



Full Funding Plan					
Year	2024	2025	2026	2027	2028
Percent Funded	68.90 %	77.38 %	56.82 %	69.90 %	86.26 %
Fully Funded Balance	\$241,206	\$265,365	\$298,876	\$256,213	\$258,187
Beginning Balance	\$135,530	\$166,187	\$205,333	\$169,831	\$179,087
Annual Contributions	\$42,429	\$43,702	\$45,013	\$46,364	\$47,755
Interest Earnings	\$1,435	\$1,817	\$1,459	\$1,544	\$1,969
Special Assessment	\$0	\$0	\$0	\$0	\$0
Reserve Expenses	\$13,207	\$6,373	\$81,974	\$38,652	\$6,091
Ending Balance	\$166,187	\$205,333	\$169,831	\$179,087	\$222,720

Expenses by Component & Year					
Components	2024	2025	2026	2027	2028
Asphalt: Resurface	\$0	\$0	\$70,896	\$0	\$0
Asphalt: Seal	\$0	\$0	\$8,258	\$0	\$0
Basketball Assembly: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Repair	\$0	\$0	\$0	\$4,383	\$0
Dock: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Swim Floats	\$0	\$0	\$0	\$17,926	\$0
Entry Monument: Repair/Replace	\$0	\$0	\$0	\$0	\$0
Fence: Chainlink, Replace	\$0	\$0	\$0	\$0	\$0
Fence: Chainlink, Replace Basket Ball Court	\$0	\$0	\$0	\$0	\$0
Gravel : Refurbish	\$0	\$0	\$2,820	\$0	\$0
Irrigation System: Repair	\$0	\$0	\$0	\$9,061	\$0
Lake: Silt & Debris Removal	\$0	\$0	\$0	\$0	\$0
Landscaping: Refurbish	\$0	\$0	\$0	\$7,282	\$0
Mower: Replace	\$13,207	\$0	\$0	\$0	\$0
Picnic Assets	\$0	\$0	\$0	\$0	\$0
Play Equipment: Rope Dome Replacement	\$0	\$0	\$0	\$0	\$0
Shed: Repair Allowance	\$0	\$6,373	\$0	\$0	\$0
Sport Court: Resurface	\$0	\$0	\$0	\$0	\$0
Storage Rack: Canoe & Peddle Boat	\$0	\$0	\$0	\$0	\$6,091
Swing Set Toy Structure: Replace	\$0	\$0	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$0	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$0	\$0	\$0	\$0



Full Funding Plan					
Year	2029	2030	2031	2032	2033
Percent Funded	92.84 %	86.48 %	91.51 %	90.68 %	89.77 %
Fully Funded Balance	\$295,554	\$342,283	\$359,387	\$388,600	\$408,987
Beginning Balance	\$222,720	\$274,380	\$295,990	\$328,880	\$352,368
Annual Contributions	\$49,187	\$50,663	\$52,183	\$53,748	\$55,361
Interest Earnings	\$2,473	\$2,680	\$2,998	\$3,223	\$3,361
Special Assessment	\$0	\$0	\$0	\$0	\$0
Reserve Expenses	\$0	\$31,733	\$22,291	\$33,483	\$43,956
Ending Balance	\$274,380	\$295,990	\$328,880	\$352,368	\$367,134

Expenses by Component & Year					
Components	2029	2030	2031	2032	2033
Asphalt: Resurface	\$0	\$0	\$0	\$0	\$0
Asphalt: Seal	\$0	\$0	\$10,193	\$0	\$0
Basketball Assembly: Replace	\$0	\$8,485	\$0	\$0	\$0
Dock: Repair	\$0	\$4,974	\$0	\$0	\$5,643
Dock: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Swim Floats	\$0	\$0	\$0	\$0	\$0
Entry Monument: Repair/Replace	\$0	\$0	\$0	\$0	\$0
Fence: Chainlink, Replace	\$0	\$0	\$0	\$22,299	\$0
Fence: Chainlink, Replace Basket Ball Court	\$0	\$0	\$0	\$0	\$0
Gravel : Refurbish	\$0	\$0	\$3,480	\$0	\$0
Irrigation System: Repair	\$0	\$0	\$0	\$11,184	\$0
Lake: Silt & Debris Removal	\$0	\$0	\$0	\$0	\$0
Landscaping: Refurbish	\$0	\$0	\$8,618	\$0	\$0
Mower: Replace	\$0	\$0	\$0	\$0	\$0
Picnic Assets	\$0	\$0	\$0	\$0	\$29,388
Play Equipment: Rope Dome Replacement	\$0	\$0	\$0	\$0	\$0
Shed: Repair Allowance	\$0	\$0	\$0	\$0	\$8,925
Sport Court: Resurface	\$0	\$18,274	\$0	\$0	\$0
Storage Rack: Canoe & Peddle Boat	\$0	\$0	\$0	\$0	\$0
Swing Set Toy Structure: Replace	\$0	\$0	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$0	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$0	\$0	\$0	\$0



Full Funding Plan					
Year	2034	2035	2036	2037	2038
Percent Funded	96.87 %	85.25 %	97.96 %	100.74 %	103.53 %
Fully Funded Balance	\$420,987	\$460,095	\$442,463	\$482,888	\$536,898
Beginning Balance	\$367,134	\$407,790	\$392,250	\$433,456	\$486,468
Annual Contributions	\$57,022	\$58,732	\$60,494	\$62,309	\$64,178
Interest Earnings	\$3,755	\$3,593	\$3,992	\$4,508	\$5,186
Special Assessment	\$0	\$0	\$0	\$0	\$0
Reserve Expenses	\$20,121	\$77,865	\$23,280	\$13,805	\$0
Ending Balance	\$407,790	\$392,250	\$433,456	\$486,468	\$555,832

Expenses by Component & Year					
Components	2034	2035	2036	2037	2038
Asphalt: Resurface	\$0	\$0	\$0	\$0	\$0
Asphalt: Seal	\$0	\$0	\$12,581	\$0	\$0
Basketball Assembly: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Repair	\$0	\$0	\$6,403	\$0	\$0
Dock: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Swim Floats	\$0	\$0	\$0	\$0	\$0
Entry Monument: Repair/Replace	\$0	\$0	\$0	\$0	\$0
Fence: Chainlink, Replace	\$0	\$0	\$0	\$0	\$0
Fence: Chainlink, Replace Basket Ball Court	\$0	\$0	\$0	\$0	\$0
Gravel : Refurbish	\$0	\$0	\$4,296	\$0	\$0
Irrigation System: Repair	\$0	\$0	\$0	\$13,805	\$0
Lake: Silt & Debris Removal	\$0	\$0	\$0	\$0	\$0
Landscaping: Refurbish	\$0	\$10,199	\$0	\$0	\$0
Mower: Replace	\$20,121	\$0	\$0	\$0	\$0
Picnic Assets	\$0	\$0	\$0	\$0	\$0
Play Equipment: Rope Dome Replacement	\$0	\$46,091	\$0	\$0	\$0
Shed: Repair Allowance	\$0	\$0	\$0	\$0	\$0
Sport Court: Resurface	\$0	\$0	\$0	\$0	\$0
Storage Rack: Canoe & Peddle Boat	\$0	\$0	\$0	\$0	\$0
Swing Set Toy Structure: Replace	\$0	\$0	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$21,575	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$0	\$0	\$0	\$0



Full Funding Plan					
Year	2039	2040	2041	2042	2043
Percent Funded	99.77 %	100.76 %	93.56 %	45.87 %	97.41 %
Fully Funded Balance	\$609,678	\$667,558	\$739,792	\$768,468	\$427,428
Beginning Balance	\$555,832	\$608,296	\$672,610	\$692,180	\$352,501
Annual Contributions	\$66,104	\$68,087	\$70,129	\$72,233	\$74,400
Interest Earnings	\$5,695	\$6,322	\$6,506	\$3,133	\$3,754
Special Assessment	\$0	\$0	\$0	\$0	\$0
Reserve Expenses	\$19,335	\$10,095	\$57,065	\$415,045	\$14,283
Ending Balance	\$608,296	\$672,610	\$692,180	\$352,501	\$416,372

Expenses by Component & Year					
Components	2039	2040	2041	2042	2043
Asphalt: Resurface	\$0	\$0	\$0	\$0	\$0
Asphalt: Seal	\$0	\$0	\$15,529	\$0	\$0
Basketball Assembly: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Repair	\$7,265	\$0	\$0	\$8,243	\$0
Dock: Replace	\$0	\$0	\$0	\$265,987	\$0
Dock: Replace	\$0	\$0	\$0	\$123,776	\$0
Dock: Swim Floats	\$0	\$0	\$0	\$0	\$0
Entry Monument: Repair/Replace	\$0	\$0	\$23,735	\$0	\$0
Fence: Chainlink, Replace	\$0	\$0	\$0	\$0	\$0
Fence: Chainlink, Replace Basket Ball Court	\$0	\$0	\$0	\$0	\$0
Gravel : Refurbish	\$0	\$0	\$5,302	\$0	\$0
Irrigation System: Repair	\$0	\$0	\$0	\$17,039	\$0
Lake: Silt & Debris Removal	\$0	\$0	\$0	\$0	\$0
Landscaping: Refurbish	\$12,070	\$0	\$0	\$0	\$14,283
Mower: Replace	\$0	\$0	\$0	\$0	\$0
Picnic Assets	\$0	\$0	\$0	\$0	\$0
Play Equipment: Rope Dome Replacement	\$0	\$0	\$0	\$0	\$0
Shed: Repair Allowance	\$0	\$0	\$12,499	\$0	\$0
Sport Court: Resurface	\$0	\$0	\$0	\$0	\$0
Storage Rack: Canoe & Peddle Boat	\$0	\$10,095	\$0	\$0	\$0
Swing Set Toy Structure: Replace	\$0	\$0	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$0	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$0	\$0	\$0	\$0



Full Funding Plan					
Year	2044	2045	2046	2047	2048
Percent Funded	94.79	62.89	95.48	85.04	99.51
Fully Funded Balance	\$492,246	\$545,413	\$421,264	\$482,155	\$492,512
Beginning Balance	\$416,372	\$466,590	\$343,037	\$402,204	\$410,046
Annual Contributions	\$76,632	\$78,931	\$81,299	\$83,738	\$86,250
Interest Earnings	\$4,240	\$3,006	\$3,580	\$3,645	\$4,426
Special Assessment	\$0	\$0	\$0	\$0	\$0
Reserve Expenses	\$30,654	\$205,490	\$25,712	\$79,541	\$10,612
Ending Balance	\$466,590	\$343,037	\$402,204	\$410,046	\$490,110

Expenses by Component & Year					
Components	2044	2045	2046	2047	2048
Asphalt: Resurface	\$0	\$0	\$0	\$0	\$0
Asphalt: Seal	\$0	\$0	\$19,167	\$0	\$0
Basketball Assembly: Replace	\$0	\$15,956	\$0	\$0	\$0
Dock: Repair	\$0	\$9,353	\$0	\$0	\$10,612
Dock: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Replace	\$0	\$0	\$0	\$0	\$0
Dock: Swim Floats	\$0	\$0	\$0	\$41,607	\$0
Entry Monument: Repair/Replace	\$0	\$0	\$0	\$0	\$0
Fence: Chainlink, Replace	\$0	\$0	\$0	\$0	\$0
Fence: Chainlink, Replace Basket Ball Court	\$0	\$49,004	\$0	\$0	\$0
Gravel : Refurbish	\$0	\$0	\$6,545	\$0	\$0
Irrigation System: Repair	\$0	\$0	\$0	\$21,031	\$0
Lake: Silt & Debris Removal	\$0	\$0	\$0	\$0	\$0
Landscaping: Refurbish	\$0	\$0	\$0	\$16,903	\$0
Mower: Replace	\$30,654	\$0	\$0	\$0	\$0
Picnic Assets	\$0	\$0	\$0	\$0	\$0
Play Equipment: Rope Dome Replacement	\$0	\$0	\$0	\$0	\$0
Shed: Repair Allowance	\$0	\$0	\$0	\$0	\$0
Sport Court: Resurface	\$0	\$34,363	\$0	\$0	\$0
Storage Rack: Canoe & Peddle Boat	\$0	\$0	\$0	\$0	\$0
Swing Set Toy Structure: Replace	\$0	\$63,945	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$0	\$0	\$0	\$0
Swing Sets: Replace	\$0	\$32,869	\$0	\$0	\$0



3. Physical Analysis

We completed a site visit as part of this reserve study on . Table 2 below shows all the components considered for funding and explains the basis of the funding decision.

3.1 Table 2: Component Funding Basis

Component	Condition	Funding Basis
Asphalt: Resurface		Funded based on current condition
Asphalt: Seal		Funded based on the typical life expectancy
Basketball Assembly: Replace		Funded based on the typical life expectancy
Dock: Repair		Funded based on current condition
Dock: Replace		Funded based on current condition
Dock: Replace		Funded based on current condition
Dock: Swim Floats		Funded based on current condition
Drainage		Unfunded due to unpredictable nature of component
Entry Monument: Repair/Replace		Funded based on the typical life expectancy
Fence: Chainlink, Replace		Funded based on the typical life expectancy
Fence: Chainlink, Replace Basket Ball Court		Funded based on the typical life expectancy
Gravel : Refurbish		Unfunded operating expense
Irrigation System: Repair		Funded for repair
Lake: Silt & Debris Removal		Funded based on Association records
Landscaping: Refurbish		Funded based on the typical life expectancy
Lights: Pole, Replace		Unfunded, not Association responsibility
Mailbox Cluster: Replace		Unfunded, not Association responsibility
Mower: Replace		Funded based on the typical life expectancy
Picnic Assets		Funded based on the typical life expectancy
Play Equipment: Rope Dome Replacement		Funded based on the typical life expectancy
Shed: Repair Allowance		Funded for repair
Signs / Pet Stations: Replace		Unfunded operating expense
Sport Court: Resurface		Funded based on the typical life expectancy
Storage Rack: Canoe & Peddle Boat		Funded based on the typical life expectancy
Streets		Unfunded, not Association responsibility
Swing Set Toy Structure: Replace		Funded based on Association records
Swing Sets: Replace		Funded based on Association records
Swing Sets: Replace		Funded based on Association records



3.2 Table 3: Component Metrics

Component	FFB	% FFB	Annual Cost	% Annual Cost
Asphalt: Resurface	\$45,408	26.54%	\$1,056	4.93%
Asphalt: Seal	\$3,690	2.16%	\$1,230	5.75%
Basketball Assembly: Replace	\$1,424	0.83%	\$356	1.66%
Dock: Repair	\$0	0.00%	\$1,043	4.87%
Dock: Replace	\$3,760	2.20%	\$1,880	8.78%
Dock: Replace	\$8,080	4.72%	\$4,040	18.87%
Dock: Swim Floats	\$7 <i>,</i> 680	4.49%	\$640	2.99%
Entry Monument: Repair/Replace	\$1,128	0.66%	\$376	1.76%
Fence: Chainlink, Replace	\$7,310	4.27%	\$430	2.01%
Fence: Chainlink, Replace Basket Ball Court	\$2,187	1.28%	\$547	2.55%
Gravel : Refurbish	\$1,260	0.74%	\$420	1.96%
Irrigation System: Repair	\$2,588	1.51%	\$1,294	6.04%
Lake: Silt & Debris Removal	\$20,000	11.69%	\$667	3.11%
Landscaping: Refurbish	\$5,200	3.04%	\$1,300	6.07%
Mower: Replace	\$5 <i>,</i> 350	3.13%	\$1,070	5.00%
Picnic Assets	\$7,172	4.19%	\$652	3.05%
Play Equipment: Rope Dome Replacement	\$8,460	4.94%	\$940	4.39%
Shed: Repair Allowance	\$1,238	0.72%	\$619	2.89%
Sport Court: Resurface	\$3,067	1.79%	\$767	3.58%
Storage Rack: Canoe & Peddle Boat	\$1,043	0.61%	\$348	1.62%
Swing Set Toy Structure: Replace	\$20,544	12.01%	\$856	4.00%
Swing Sets: Replace	\$10,560	6.17%	\$440	2.06%
Swing Sets: Replace	\$3,960	2.31%	\$440	2.06%
Current Fully Funded Balance	\$171,107		\$21,410	Per Year
Current Reserve Fund Deficit/Surplus	(\$151,111)		\$1,784	Per Month

This table shows metric information regarding the influence each component has on the fully funded balance and contribution requirements.



3.3 Component Details

0.0 00			
Site/Grounds - Asphalt: Res	urface		
Quantity:	19204 Square Feet	UL:	50
		RUL:	7
Funding Basis:	Funded based on current condition	Current Cost:	\$52,800.00
Site/Grounds - Asphalt: Sea	I		
Quantity:	19204 Square Feet	UL:	5
		RUL:	2
Funding Basis:	Funded based on the typical life expectancy	Current Cost:	\$6,150.00
Recreation - Basketball Asse	embly: Replace		
Quantity:	2 Each	UL:	15
		RUL:	11
Funding Basis:	Funded based on the typical life expectancy	Current Cost:	\$5,340.00
Site/Grounds - Dock: Repair	r		
Quantity:	1 Allowance	UL:	3
		RUL:	8
Funding Basis:	Funded based on current condition	Current Cost:	\$3,130.00
Site/Grounds - Dock: Replac	ce		
Quantity:	425 Square Feet	UL:	25
		RUL:	23
Funding Basis:	Funded based on current condition	Current Cost:	\$101,000.00
Site/Grounds - Dock: Replace	ce		
Quantity:	220 Square Feet	UL:	25
		RUL:	23
Funding Basis:	Funded based on current condition	Current Cost:	\$47,000.00
Site/Grounds - Dock: Swim	Floats		
Quantity:	3 Units	UL:	20
		RUL:	8
Funding Basis:	Funded based on current condition	Current Cost:	\$12,800.00
Site/Grounds - Drainage			



Funding Basis:	Unfunded due to unpredictable nature of component	
Site/Grounds - Entry Monu	ment: Repair/Replace	
Quantity:	1 Allowance	UL: 25
		RUL: 22
Funding Basis:	Funded based on the typical life expectancy	Current Cost: \$9,400.00
Site/Grounds - Fence: Chain	llink, Replace	
Quantity:	588 Linear Feet	UL: 30
		RUL: 13
Funding Basis:	Funded based on the typical life expectancy	Current Cost: \$12,900.00
Site/Grounds - Fence: Chain	link, Replace Basket Ball Cou	rt
Quantity:	438 Linear Feet	UL: 30
		RUL: 26
Funding Basis:	Funded based on the typical life expectancy	Current Cost: \$16,400.00
Site/Grounds - Gravel : Refu	urbish	
Quantity:	1 Allowance	UL: 5
		RUL: 2
Funding Basis:	Unfunded operating expense	Current Cost: \$2,100.00
Site/Grounds - Irrigation Sys	stem: Repair	
Quantity:	1 Allowance	UL: 5
		RUL: 3
Funding Basis:	Funded for repair	Current Cost: \$6,470.00
Site/Grounds - Lake: Silt & I	Debris Removal	
Quantity:	1 Allowance	UL: 30
		RUL: 0
Funding Basis:	Funded based on Association records	Current Cost: \$20,000.00
Site/Grounds - Landscaping	: Refurbish	
Quantity:	1 Allowance	UL: 4
		RUL: 0
Funding Basis:	Funded based on the typical life expectancy	Current Cost: \$5,200.00
Site/Grounds - Lights: Pole,	Replace	



Funding Basis: Unfunded, not Association responsibility

Site/Grounds - Mailbox Cluster: Replace

Funding Basis:	Unfunded, not Association responsibility	
Mechanical & Equipment -	Mower: Replace	
Quantity:	1 Unit	UL: 10
		RUL: 5
Funding Basis:	Funded based on the typical life expectancy	Current Cost: \$10,700.00
Site/Grounds - Picnic Assets	5	
Quantity:	1 Allowance	UL: 25
		RUL: 14
Funding Basis:	Funded based on the typical life expectancy	Current Cost: \$16,300.00
Recreation - Play Equipmen	t: Rope Dome Replacement	
Quantity:	1 Unit	UL: 25
		RUL: 16
Funding Basis:	Funded based on the typical life expectancy	Current Cost: \$23,500.00
Building - Shed: Repair Allo	wance	
Quantity:	1 Allowance	UL: 8
		RUL: 6
Funding Basis:	Funded for repair	Current Cost: \$4,950.00
Site/Grounds - Signs / Pet S	tations: Replace	
Quantity:	5 Items	
Funding Basis:	Unfunded operating expense	
Site/Grounds - Sport Court:	Resurface	
Quantity:	1 Allowance	UL: 15
		RUL: 11
Funding Basis:	Funded based on the typical life expectancy	Current Cost: \$11,500.00
Site/Grounds - Storage Racl	k: Canoe & Peddle Boat	
Quantity:	3 Units	UL: 12
		RUL: 9



Funding Basis:	Funded based on the typical life expectancy	Current Cost: \$4,170.00
Site/Grounds - Streets		
Funding Basis:	Unfunded, not Association responsibility	
Recreation - Swing Set Toy	Structure: Replace	
Quantity:	1 Unit	UL: 25
		RUL: 1
Funding Basis:	Funded based on Association records	Current Cost: \$21,400.00
Recreation - Swing Sets: Re	place	
Quantity:	1 Allowance	UL: 25
		RUL: 16
Funding Basis:	Funded based on Association records	Current Cost: \$11,000.00
Recreation - Swing Sets: Re	place	
Quantity:	1 Allowance	UL: 25
		RUL: 1
Funding Basis:	Funded based on Association records	Current Cost: \$11,000.00



4. How to Read Your Reserve Study

This reserve study is an important planning tool that contains long-term common area replacement and financial recommendations for your Association. In order to accomplish this, we provide you with critical information that should be considered when evaluating the current health of your reserve fund, future maintenance, repair and replacement expenses and reserve contribution rates to include within the regular unit owner assessments. With the use of this reserve study your Association will be better prepared for present and future expenses.

We have worked to identify your common area assets, called **components**, which have maintenance or replacement expenses that can be anticipated. Our recommendations should help to minimize deferred maintenance and special assessments, as well as maximize your property value.

Having properly funded reserves enables the Association to keep the common area assets in good condition. When potential buyers consider which association to purchase a home in, the overall condition of the association and reserve fund may be considered. Having good financials, maintenance, and curb appeal, all work together to increase your property value.

We know that your needs are different from the needs of others. Therefore, we have created this report specifically for your Association. When possible, we have had discussions with the Association Board of Directors, vendors and professional management to provide recommendations that will help you meet your Association's goals and objectives.

4.1 About Reserve Studies

By definition a reserve study is a budget planning tool. It identifies the current status of the reserve fund with a stable and equitable funding plan, to offset the anticipated future major common area expenditures. Plainly, a reserve study is a long term plan that indicates how much money needs to be set aside to pay for future expenses. The reserve study consists of two parts: the physical analysis and financial analysis.

The **physical analysis** identifies which components are appropriate for reserve funding and the current physical condition assessment of each asset; then indicates the life expectancy or useful life of the component as well as the life remaining or remaining useful life of each component. The physical analysis is concluded with the current cost to replace each component. The physical analysis information is used within the financial analysis. Therefore, it generally contains many recommendations and justifications regarding component repair, maintenance and replacement recommendations as well as cost and life cycles.

The **financial analysis** includes two results. First, it reveals the health of the reserve fund. This is completed by determining the current status of the reserve fund known as percent funded. The second result is the reserve contribution recommendation. Using the information contained within the physical analysis, the future expected expenses are analyzed and reviewed. Then multi-year funding plans are developed to meet various funding goals. The reserve contributions required to meet the funding goal desired is then presented and recommended to the Association.

4.2 Reserve Study Levels

• Level I: Full Reserve Study Funding Analysis and Plan. This is the most labor intensive reserve study, as it includes both a physical and financial analysis. The component inventory list and current component condition assessments with life and valuation estimates are determined from an on-site visual inspection. This information is used to conduct the financial analysis, which includes the current fund status and a recommended funding plan. A "Full Reserve Study" is recommended when a previous reserve study is not available, a substantial time has elapsed since the last study (7-10)



years), or there are concerns with an existing reserve study's component inventory or measurements.

- Level II: Update with Visual Site Inspection. This report updates both the physical analysis and financial analysis of an existing report. An on-site visual inspection is conducted to verify and/or make adjustments to the existing component list, condition assessments, useful life and component valuation estimates. The financial analysis is also updated, including the current fund status and recommended funding plan. A level II report is recommended at least every three years, before and after major projects and as required by state law.
- Level III: Update with No Visual Site Inspection. This report updates the financial analysis of an existing reserve study only. No on-site visual inspection is completed. An existing fund status and funding plan is updated using research conducted with board members, vendors, association managers and information contained within a prior reserve study. A level III report is recommended to review, adjust and verify that the existing funding plan is accurate and suitable for current economic conditions. A level III report is recommended at least annually.

4.3 Percent Funded

Percent funded is a way to measure the strength of the reserve fund. The Community Associations Institute (CAI) defines "Percent Funded" as "the ratio, at a particular point of time, of the actual (or projected) Reserve Balance to the Fully Funded Balance, expressed as a percentage." The **fully funded balance** is the total accrued depreciation or deterioration of the component(s). This balance is the cost of how much life has been used up. The fully funded balance is then used as an indicator against which the actual (or projected) reserve fund balance can be compared; known as percent funded.

For example, if an association were to replace interior carpeting in 10 years at an expense of \$10,000; then each year the cost of deterioration is 1/10th of the replacement cost. Therefore, each year \$1,000 of cost is accrued. In year 2, the fully funded balance would be \$2,000. In year 5, the cost of existing deterioration is \$5,000, and so on. To determine the percent funded, the FFB is compared to the reserve fund balance. To continue the above example, the association has \$2,000 in their reserve fund in year 2. The total accrued deterioration or FFB is \$2,000, therefore they are 100% funded. The association has saved 100% of the accrued deterioration or fully funded balance. If they have set aside only \$1,000, the association is 50% funded, having saved 50% of the existing deterioration or cost.

Using Percent Funded to Measure Strength

- **0-30% Funded is a "weak" status.** There is a lack of funds reserved toward the amount of accrued deterioration. Whenever an association has a weak status there is an increased possibility of requiring special assessments, loans or deferred maintenance.
- **31-69% Funded is a "fair" status.** There is a decreased chance of requiring special assessments or deferred maintenance, however, cash flow problems may very easily arise.
- **70-100% Funded is a "strong" status.** Associations in this range generally have financial stability. There are generally no cash flow issues, special assessments or deferred maintenance necessary.
- **100% Funded is known as "ideal."** The reserve fund balance equals the fully funded balance. This is "ideal" because funds are reserved as components are used. It is thought to be the most fair for members because they pay as they go, or they pay their share.

Use Caution When Using Percent Funded

Percent funded is a ratio and therefore does not convey the urgency that is often times required. There are two aspects that need to be considered when evaluating the urgency of the current situation, the time remaining before an expense is scheduled to occur, as well as the cost of the expense.



The first aspect that percent funded does not consider is the time remaining before the expense is to occur. Use the same carpet replacement example (\$10,000 carpet expense to be saved over 10 years). If, in year 5 they have only saved \$2,500 they are 50% funded (remember the total accrued deterioration or FFB would be \$5,000). To have the capital required to complete the project as scheduled in year 10 for \$10,000, they would need to save \$1,500 each year for the next 5 years.

Changing the time frames, if in year 10 they have set aside \$5,000, they would still be 50% funded (having saved 50% of the total accrued deterioration of \$10,000). However, they now need to attain \$5,000 of the required \$10,000 expense immediately rather than over a period of time.

These examples show that the percent funded ratio lacks the urgency that each association may have in attaining the rest of the financing.

Percent funded also does not consider the cost of the expense. Using the same 10 year cycle, changing the cost of the required expense from \$10,000 to a \$30,000 paint project, in year 5 the association is 50% funded by having set aside \$15,000. In this case, they must save \$3,000 each year, not \$1,500. If in year 10, they are 50% funded, they would need to save \$15,000 not \$5,000. Notice how the percent funded is the same, but the amount needed to meet the financial obligation is very different.

Percent funded is a very useful ratio, however, it must be placed in context. Remember to evaluate not only the percent funded but also the cash balance and size of the upcoming expenditures as well.

4.4 Reserve Funding Plans & Goals

To determine the contribution rate to the reserve fund, the association needs to determine their reserve fund goal. This may be based on a number of objectives and analysis' corresponding to the reserve fund. There are three different funding goals associations may choose based on their risk tolerance:

- **Baseline Funding Goal** This sets the reserve contribution amount as low as possible without the reserve fund dropping below a zero balance. This is the most risky method with the least contributed to the reserve fund. If an expense arrives early, or unexpected, there is a significant chance of needing a special assessment or loan.
- **Threshold Funding Goal** The goal of Threshold Funding is to set the reserve contribution amount to meet a specified goal. Common goals to achieve and maintain are 70 Percent Funded, to maintain a cash-balance of 15% of the prior year's expenses, or to maintain a minimum cash-balance of the prior year's reserve contribution amount.
- **Full Funding Goal** Sets the goal at being fully funded. This plan sets the reserve contribution amount to achieve a fully funded balance. Fully funded is achieved when the percent funded is 100%. It requires the largest contribution to the reserve fund of the three goals, but is also the least risky.

4.5 Reserve Contributions

There are three ways to contribute to your Reserve Account:

• **Regular Contributions:** If adequate regular contributions are not established the reserve fund will eventually be underfunded. An underfunded reserve account leads to deferred maintenance and potentially extensive repair. As already mentioned, the effects of deferred maintenance and extensive repair are significantly more than routine or preventative maintenance. Additionally, it is the most fair and equitable to the association members. If reserve contributions are not set properly, whether too high or low, the individuals who use the asset will not be paying for it. If the contributions are set too high, current owners are paying for what future owners should pay for.

CEDC

Likewise, when contributions are set too low, future owners will pay for what current owners should have paid for. Having properly set reserve contributions is the most fair for everyone involved.

- **Special Assessments:** If the reserve fund is underfunded at the time an expense is required, the association is forced to hold a special assessment. Most often, this occurs when deferred maintenance catches up and the association is forced to deal with it. It is better to have a small monthly increase now rather than a very large and unexpected increase later.
- Loans: If the association members do not have the finances to contribute to a special assessment or the required repairs are too extensive and costly for a special assessment, a loan may be required. This not only requires a monthly increase in dues, but members are then paying for past as well as future expenses, rather than just future expenses. The future still needs to be anticipated and saved for.

4.6 Reserve Components

The components of a reserve study have significant impact on the accuracy of the report. If items are improperly included or excluded from the reserve study, then the projected expenses and subsequent required reserve contributions will likewise be affected. Before a component is included within the reserve study, it is evaluated and qualified using a nationally recognized four-part test:

- **Common Area:** The component must be association responsibility; limited common areas may be included.
- Limited Useful Life: The life of the component must be limited.
- **Predictable Life:** The limited life must be predictable.
- **Minimum Threshold Cost:** Generally greater than 1% of the annual operating budget or \$1,000 whichever is greater.

Repairs or replacements of components that are predicted to have an estimated remaining useful life exceeding this 30-year report period are generally not included. Items that are below the minimum threshold cost, or reoccur annually are generally included within the annual operating budget. Expenses that are necessitated by acts of nature, accidents or other occurrences that are more properly insured for, rather than reserved for, are also excluded.

Maintaining Components

There are three ways to manage capital reserve expenses:

- **Preventative Maintenance:** This is the most effective way to extend the useful life of components and save money in the long run, as it is a proactive maintaining of components. The cost of maintaining the condition and quality of a component is much less than repair or replacing the component to bring it back to a usable condition and may also prolong the life expectancy of an asset.
- **Deferred Maintenance:** This is deferring routine maintenance rather than completing maintenance as recommended. A common household example of this is deferring the oil changes in a vehicle. Deferred maintenance is likely the first indication of, and results in, having inadequate reserve funds. While in the short run the association is contributing less money, the effects of deferring maintenance and the costs associated with it are far greater than the cost of preventative maintenance.
- Extensive Repair or Replacement: This is when a component needs to have significant repair(s) completed or even replacement prior than anticipated. While not always, this is generally a result of deferred maintenance. The cost of significant repair or advanced replacement is not only expensive, it also decreases association morale through poor association management, poor curb appeal and out of commission assets.

CEDC

4.7 Implementing Your Reserve Study

- **Step 1 Understand:** The board of directors has the responsibility to lead the association, therefore, the first step is for the board to hold a meeting. This meeting should discuss the results of the reserve study in order for the Board to better understand the current position of the association and the upcoming reserve requirements of the association.
- **Step 2 Plan:** The board should then create a plan to determine how best to manage the association's common area assets and financial position. Using this reserve study as a guide, the board should make the adjustments required to meet the needs of the association and its members. This includes setting the reserve contribution amount.
- **Step 3 Communicate:** After the board has determined the best course of action, the plan needs to be communicated to the association members. This can be accomplished through the distribution of the results of this reserve study and/or through association meetings. This allows them to ask questions and understand the direction the association will be heading.
- Step 4 Update and Adjust: Reserve studies are a one-year document, and need to be updated and adjusted annually. We recommend additional collaboration with specialized professionals to provide the expertise and adjustments to this reserve study. Additionally, we recommend the board review and make minor adjustments of this plan before and after reserve projects throughout the year.

5. Supplemental Report Information

5.1 Definitions

COMPONENT: The individual line items in the Reserve Study developed or updated in the Physical Analysis. These elements form the building blocks for the Reserve Study. Components are defined as being:

- 1. Association responsibility
- 2. Having a limited Useful Life expectancy
- 3. Predictable Remaining Useful Life expectancies
- 4. Above a minimum threshold cost
- 5. As required by law

DEFICIT/SURPLUS: The Reserve Balance less the Fully Funded Balance.

FULLY FUNDED BALANCE (FFB): Equivalent to Total Accrued Depreciation. This represents the deteriorated or used portion of the component. This is calculated for each component, then summed together for a total FFB. FFB = Current Cost X Effective Age / Useful Life

PERCENT FUNDED: The ratio at a particular point of time of the actual (or projected) Reserve Balance to the Fully Funded Balance, expressed as a percentage.

PROJECTED RESERVE BALANCE: The anticipated reserve balance on the first day of the fiscal year for which this report has been prepared. This is based upon information provided and not audited.

REMAINING USEFUL LIFE (RUL): The estimated time, in years, that a reserve component can be expected to continue to serve its intended function.

REPLACEMENT COST: The cost of replacing, repairing, or restoring a Reserve Component to its original functional condition. The Current Replacement Cost would be the cost to replace, repair, or restore the component during that particular year.

USEFUL LIFE (UL): The estimated time, in years, that a reserve component can be expected to serve its intended function if properly constructed in its present application or installation.



5.2 Table 4 - RCW Required Information & Location

RCW Required Information	Report Location
(a) A reserve component list, including any reserve component that would cost more than one percent of the annual budget of the association, not including the reserve account, for major maintenance, repair, or replacement. If one of these reserve components is not included in the reserve study, the study should provide commentary explaining the basis for its exclusion. The study must also include quantities and estimates for the useful life of each reserve component, remaining useful life of each reserve component, and current major maintenance, repair, or replacement cost for each reserve component;	Table 1 Table 4
(b) The date of the study and a statement that the study meets the requirements of this section;	Disclosure Page
(c) The level of reserve study performed:	Cover Page
(d) The association's reserve account balance;	Executive Summary
(e) The percentage of the fully funded balance that the reserve account is funded;	Executive Summary Financial Summary
(f) Special assessments already implemented or planned;	Executive Summary Financial Summary
(g) Interest and inflation assumptions;	Executive Summary Financial Summary
(h) Current reserve account contribution rate;	Executive Summary Financial Summary
(i) Recommended reserve account contribution rate; a contribution rate for a full funding plan to achieve one hundred percent fully funded reserves by the end of the thirty-year study period, a baseline funding plan to maintain the reserve balance above zero throughout the thirty-year study period without special assessments, and a contribution rate recommended by the reserve study professional;	Executive Summary Financial Summary
(j) Projected reserve account balance for thirty years and a funding plan to pay for projected costs from those reserves without reliance on future unplanned special assessments;	Spread Sheet of Reserve Expenses
(k) Whether the reserve study was prepared with the assistance of a reserve study professional.	Executive Summary
(3) A reserve study shall include the following disclosure: "This reserve study should be reviewed carefully. It may not include all common and limited common element components that will require major maintenance, repair, or replacement in future years, and may not include regular contributions to a reserve account for the cost of such maintenance, repair, or replacement. The failure to include a component in a reserve study, or to provide contributions to a reserve account for a component, may, under some circumstances, require you to pay on demand as a special assessment your share of common expenses for the cost of major maintenance, repair, or replacement of a reserve component."	Disclosure Page



5.3 Reserve Study Disclosure

This document is the sole opinion of CEDCORE, LLC and has been provided pursuant to an agreement containing restrictions on its use. No part of this document may be copied or distributed, in any form or by any means, nor disclosed to third parties without the expressed written permission of CEDCORE. The client shall have the right to reproduce and distribute copies of this report, or the information contained within, as may be required for compliance with all applicable regulations.

This reserve study and the parameters under which it has been completed are based upon information provided to us in part by representatives of the association, its contractors, assorted vendors, specialists and independent contractors. The site visit is a limited scope visual observation of the surface condition of identified and exposed components. Hidden systems including but not limited to mechanical, electrical, structural, plumbing, storm water, sewer, water supply, foundations, etc. are beyond the scope of a reserve study. No destructive testing was undertaken, nor does this study purport to address any latent and/or patent defects or life expectancies which are abnormally short due to either improper design and/or installation or due to subsequent improper maintenance. It is assumed that all components are to be reasonably maintained for the remainder of their life expectancy.

Various construction pricing and scheduling manuals may be used as well as costs and life expectancies obtained from numerous vendors, vendor catalogues, actual quotations or historical costs, and our own experience in the field of Reserve Study preparation.

It has been assumed, unless otherwise noted in this report, that all assets have been designed and constructed properly and that each estimated Useful Life will approximate that of the norm per industry standards and/or manufacturer's specifications. In some cases, estimates may have been used on assets, which have an indeterminable but potential liability to the association. The decision for the inclusion of these as well as all assets considered is left to the client.

We recommend that your Reserve Study be updated on an annual basis due to fluctuating interest rates, inflationary changes, and the unpredictable nature of the useful life and cost of many of the assets under consideration.

This Reserve Study is provided as an aid for planning purposes and not as an accounting tool. Since it deals with events yet to take place, there is no assurance that the results enumerated within it will, in fact, occur as described. Additionally, other unanticipated expenses may arise that are not included within this reserve study. This reserve study should be reviewed carefully. It may not include all common and limited common element components that will require major maintenance, repair, or replacement in future years, and may not include regular contributions to a reserve account for the cost of such maintenance, repair, or replacement. The failure to include a component in a reserve study, or to provide contributions to a reserve account for a component, may, under some circumstances, require you to pay on demand as a special assessment your share of common expenses for the cost of major maintenance, repair, or replacement of a reserve component. This Reserve Study was prepared by or under the direct supervision of a Reserve Specialist following National Reserve Study Standards and complies with RCW 64.34.382 and 64.38.070. This Reserve Study needs to be updated annually as well as when any new material information is obtained.



3800 Bridgeport Way W, Suite A464 University Place, WA 98466 884-560-8070 www.cedcore.com